




ASSEMBLY INSTRUCTION

NC3FXCC | XLR Cable Connector

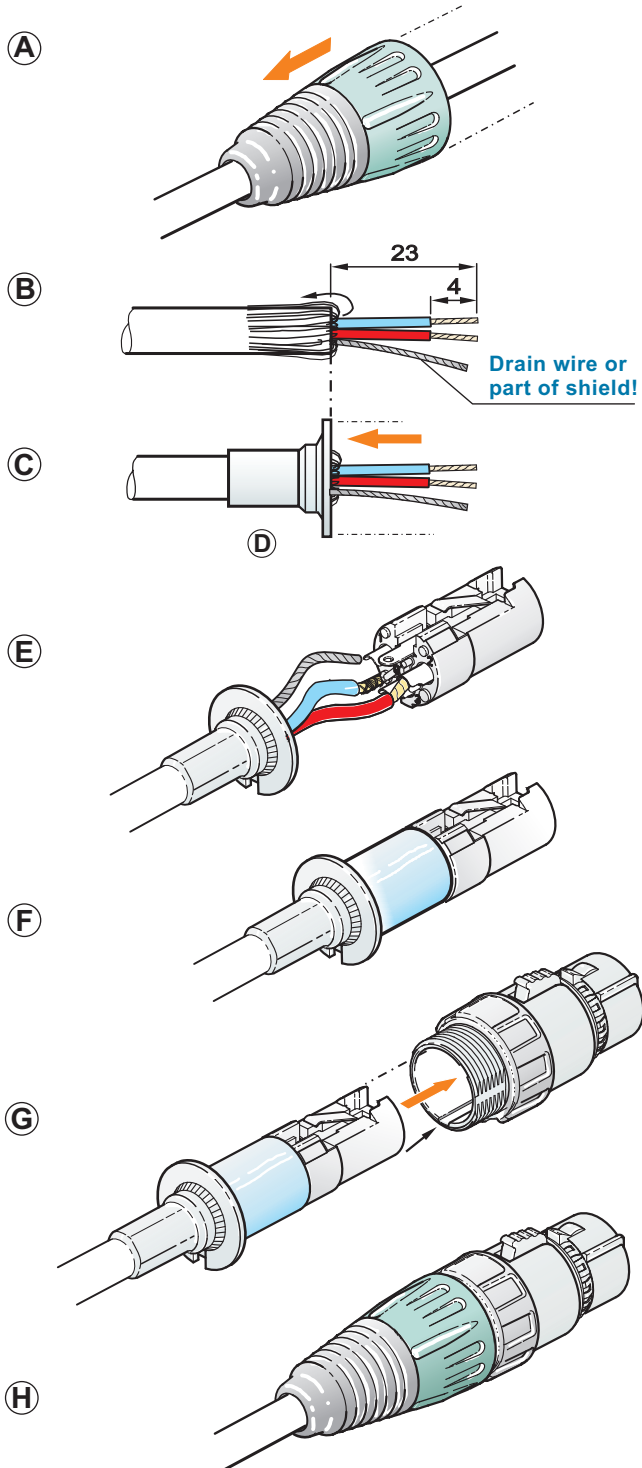

- A** Slide the boot onto the cable.
- B** Prepare cable as shown. Fold back the shield. If the cable does not offer a drain wire, twist a part of the shield for contact # 1 shield wiring.
- C** Slide the crimp strain relief onto the cable jacket to the position as indicated.
- D** Crimp the strain relief by means of HEX crimp dies of width 6.5 mm (size "E" acc. to IEC 60803).
- E** Solder the wire ends to contacts # 2 and # 3 of insert.
- F** Position the distance sleeve between strain relief and insert.
- G** Align the nose of the crimp strain relief and the recess of the distance sleeve with respect to one of the keyways.
Slide the unit into the connector housing.
- H** Finish the installation by turning the bushing onto the connector.

NOTE: To keep the strain relief in the keyway, avoid rotation of the cable during assembly.

NEUTRIK AG
NEUTRIK Zürich AG
NEUTRIK USA Inc.
NEUTRIK (UK) Ltd.

LI
CH
USA
UK

T: +423 / 237 24 24 F: +423 / 232 53 93
T: +41 44 / 736 5010 F: +41 44 / 736 5011
T: +1 732 / 901 9488 F: +1 732 / 901 9608
T: +44 1983 / 811 441 F: +44 1983 / 811 439

NEUTRIK Vertriebs GmbH
NEUTRIK France
NEUTRIK Tokyo Ltd.
NEUTRIK Hong Kong Ltd.

DE/NL/AT
FR
JP
HK

T: +49 8131 / 280 890 F: +49 8131 / 280 830
T: +33 1 / 4131 6750 F: +33 1 / 4131 0511
T: +81 3 / 3663 4733 F: +81 3 / 3663 4796
T: +852 / 2687 6055 F: +852 / 2687 6052