

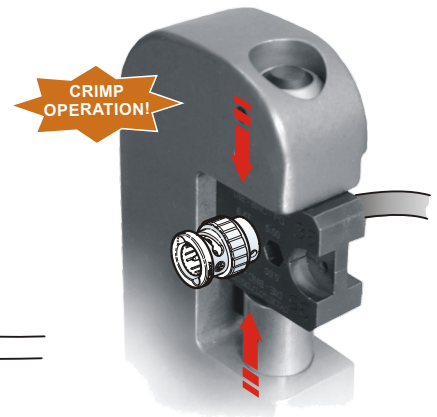
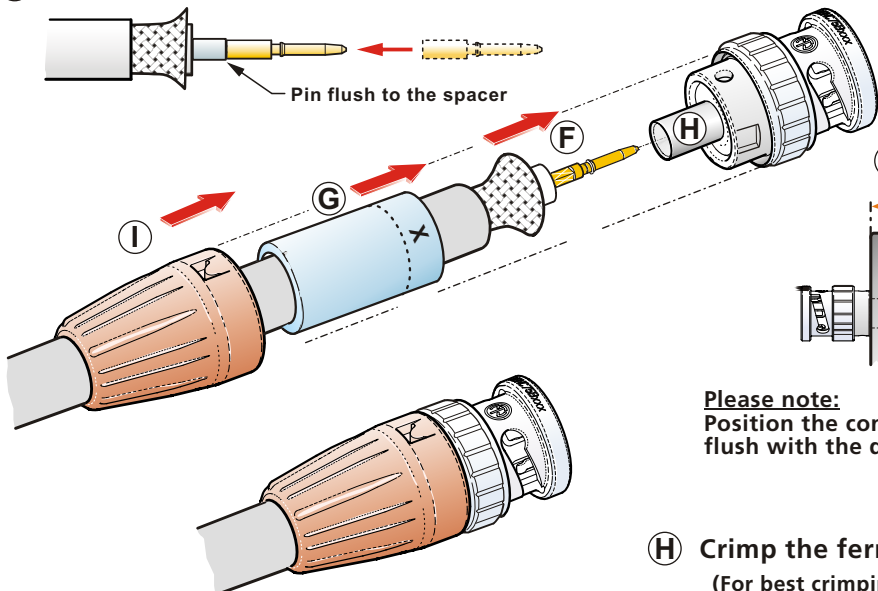
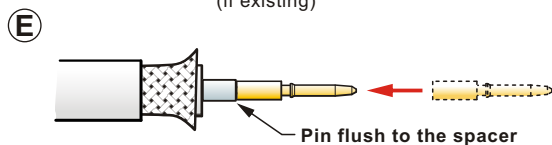
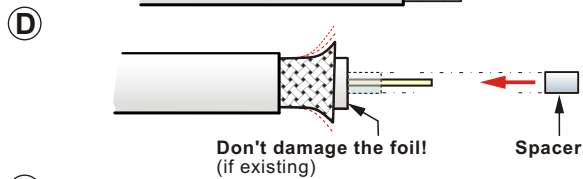


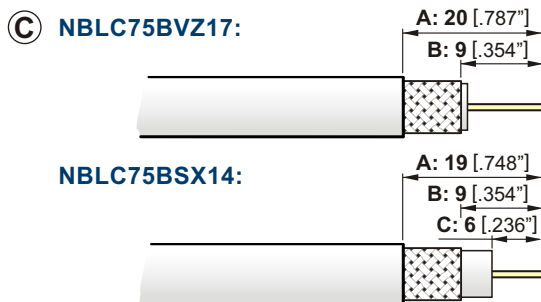

ASSEMBLY INSTRUCTION

Rear Twist BNC - "Large" | 75Ω Cable Connector - Crimp version

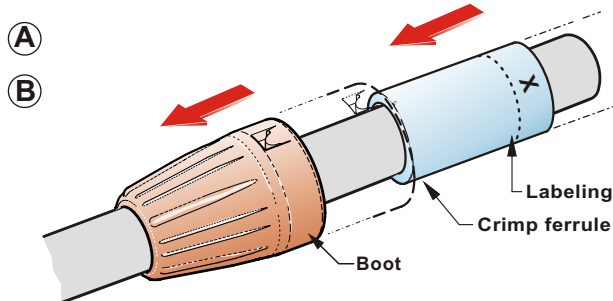

Please note:
Position the connector body
flush with the die face.

- A** Slide the boot onto the cable
 - Position the labeling to the cabelend
- B** Slide the crimp ferrule onto the cable
- C** Prepare cable as shown
 - Use an adjustable coaxial cable stripper
- D** Spread the braided shield
 - slide the spacer onto the center conductor
- E** Crimp the pin
 - position the pin on the center conductor
 - crimp the pin with the tool
 - (For best crimping-results it is recommended to use the original Neutrik crimp tool
 - HXBNC with the corresponding insert
 - hexcrimp acc. to IEC 803-W (SW 1.75)
 - squarecrimp acc. to IEC 803-2 (SW 1.6)
 - Pin can also be soldered (Optional)!
 - Straighten the pin if misaligned.
- F** Insert the cable into the connector body
- G** Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to it's end position until you hear a snap noise.
- H** Crimp the ferrule with the tool
 - (For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)
- I** Snap the boot onto the connector body

NEUTRIK AG LI T: +423 / 237 24 24 F: +423 / 232 53 93
 NEUTRIK USA Inc. USA T: +1 704 / 972 3050 F: +1 704 / 438 9202
 NEUTRIK (UK) Ltd. UK T: +44 1983 / 811 441 F: +44 1983 / 811 439
 NEUTRIK Vertriebs GmbH DE/NL/AT/DK T: +49 8131 / 280 890 F: +49 8131 / 280 830

NEUTRIK France FR T: +33 1 / 4131 6750 F: +33 1 / 4131 0511
 NEUTRIK Tokyo Ltd. JP T: +81 3 / 3663 4733 F: +81 3 / 3663 4796
 NEUTRIK Hong Kong Ltd. HK T: +852 / 2687 6055 F: +852 / 2687 6052

Draft. Nr.: BDA 144 / 3102M1351 | Update: 18.06.2013 | Data subject to change without prior notice. ©2013 NEUTRIK®. ALL RIGHTS RESERVED.

www.neutrik.com

NEUTRIK®