








# ASSEMBLY INSTRUCTION

## rearTWIST UHD BNC

### 75Ω Cable Connector Crimp version


UHD 4K8K

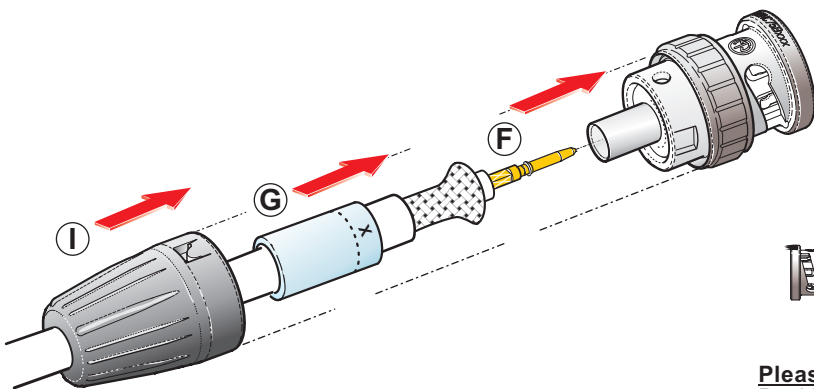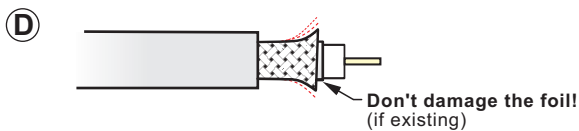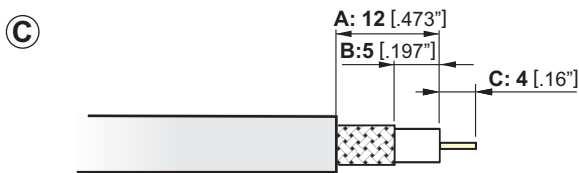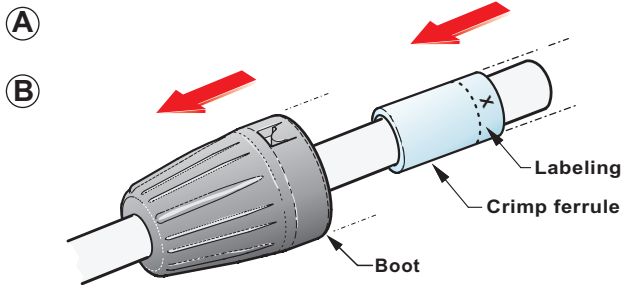

**A** Slide the boot onto the cable  
- Position the labeling to the cable end

**B** Slide the crimp ferrule onto the cable


**C** Prepare cable as shown  
- Use an adjustable coaxial cable stripper

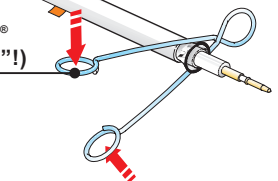**D** Spread the braided shield  
(It's easily with the NEUTRIK® "SHIELD-SPREADING-TOOL"!) 

**E** Crimp the pin  
- position the pin on the center conductor  
- Crimp the pin with the tool  
(For best crimping-results it is recommended to use the original Neutrik crimp tool HX-R-BNC with appropriate crimp die)  
- Straighten the pin if misaligned.

**F** Insert the cable into the connector body

**G** Slide the crimp ferrule over the shield to the front and push the cable to its end position until you hear a snap noise.

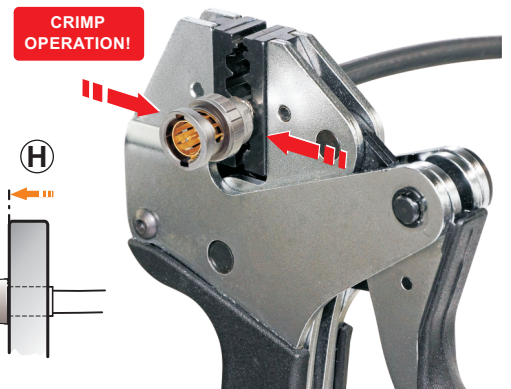


**Please note:**  
Position the connector body  
Flush with the die face.

**H** Crimp the ferrule with the tool  
(For best crimping-results it is recommended to use the original Neutrik tool - HX-R-BNC with the corresponding insert)

**I** Snap the boot onto the connector body

Assembled Connector

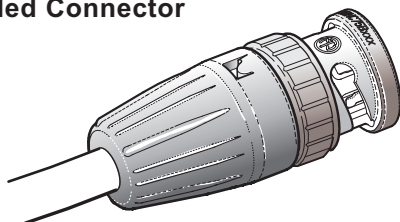

NEUTRIK AG	LI	T: +423/237 24 24	F: +423/232 53 93	NEUTRIK France	FR	T: +33 1/4131 6750	F: +33 1/4131 0511
NEUTRIK USA Inc.	USA	T: +1 704 / 972 3050	F: +1 704/438 9202	NEUTRIK Tokyo Ltd.	JP	T: +81 3/3663 4733	F: +81 3/3663 4796
NEUTRIK (UK) Ltd.	UK	T: +44 1983 / 811 441	F: +44 1983/811 439	NEUTRIK Hong Kong Ltd.	HK	T: +852/2687 6055	F: +852/2687 6052
NEUTRIK Vertriebs GmbH	DE/NL/AT/DK	T: +49 8131 / 280 890	F: +49 8131/280 830	NEUTRIK India Pvt. Ltd.	IND	T: +91/982 05 43 424	F: +91/22 26163 540

Draft. Nr.: BDA 398 | Update: 15.04.2015 | Data subject to change without prior notice. ©2015 NEUTRIK®. ALL RIGHTS RESERVED. NEUTRIK® are registered trademark.

www.neutrik.com

NEUTRIK®